
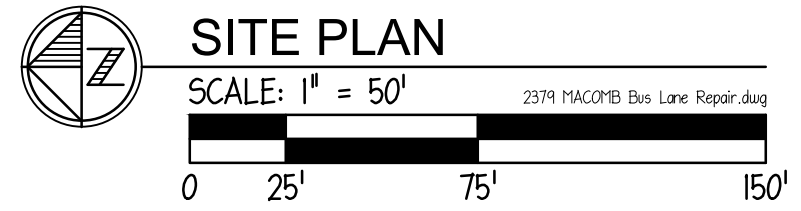


- NOTES:
1. REMOVE AND REPLACE APPROXIMATELY 246' X 24' OF EXISTING 8" CONCRETE PAVING.
 - a. THERE ARE TWO COLLAPSED AREAS ABOUT 8' X 10', EXCAVATE BASE 12" AND INFILL WITH GRANULAR FILL COMPACTED.
 - b. PROOF ROLL REMAINING BASE AND SHAPE, EXCAVATE AS NEEDED OR ADD GRANULAR FILL AS NEED AFTER PROOF ROLL.
 - c. NEW PAVING TO BE 8" CONCRETE WITH 6X6 W4.0 X W4.0 (6"X6" 4/4) WWF APPROXIMATELY AT MID HEIGHT OF POUR. FOLLOW EXISTING GRADES, CROWN OR SIDE SLOPE SLIGHTLY AS APPROPRIATE TO ASSURE DRAINAGE.
 - d. PROVIDE GREEN CUT CONTRACTION JOINTS AT 15' CENTERS (MAY BE UP TO 17' IF APPROPRIATE FOR UNIFORM SPACING IN POUR LENGTH).
 - e. APPLY ACRYLIC CURE AND SEAL.
 - f. PROVIDE DOWEL BASKETS AT ALL JOINTS, COLD JOINTS OR CONTRACTION JOINTS, DOWELS TO BE 3/4" EPOXY COATED X 18" SPACED AT 12" MID HEIGHT OF SLAB.
 - g. AT CONCLUSION OF WORK, CLEAN JOINTS OF DEBRIS AND DIRT AND NEATLY SEAL WITH POLYMER ASPHALTIC JOINT SEAL EMULSION, PREFERABLY HOT APPLIED, BUT COLD IS ALLOWED.
 2. SITE WORK, REPAIR ALL DAMAGED SOD, REPAIR WITH TOP SOIL AND RESEED AS APPROPRIATE.

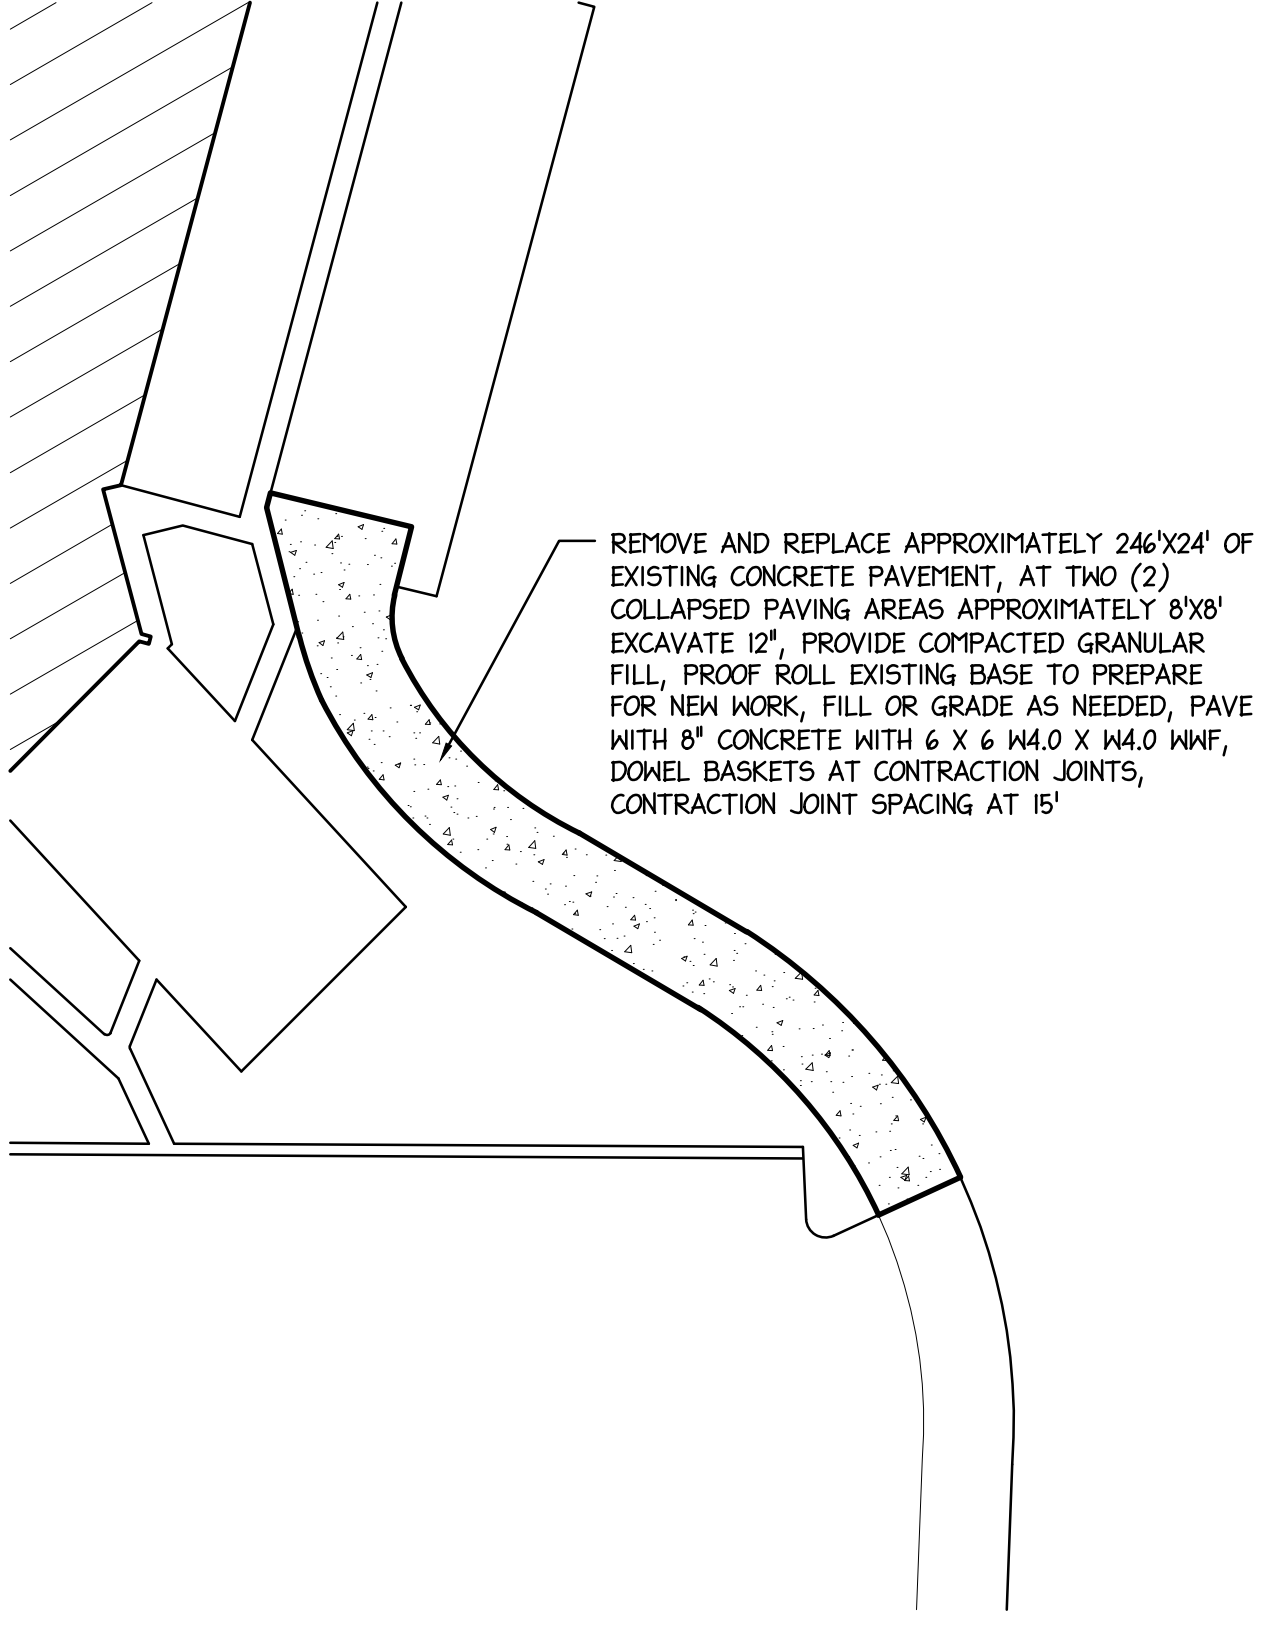

PROJECT NO. 23790218		ISSUE DATE MARCH 28, 2018		SHEET C-1		OF 1 SHEETS	
2018 BUS LANE REPAIR				MACOMB JrSHS - 1525 S. JOHNSON ST. - MACOMB, IL 61455			
MIDDLETON ASSOCIATES, INC ARCHITECTS				1702 W. College Ave. Suite E Normal, IL 61761-2793 P: 309.452.1271 F: 309.454.8049 middletonassociates.net			
THE CONTRACTOR SHALL VERIFY CONDITIONS & DIMENSIONS ON THE JOB. INFORMATION SHOWN ON ANY PART OF THE DRAWINGS SHALL APPLY TO SIMILAR CONDITIONS AT OTHER LOCATIONS IN THE WORK UNLESS SET FORTH OTHERWISE							
REVISIONS	NO.	DATE	REMARKS				